Technical Bulletin

Model(s)
42WLG66, 42WLT66, 47WLG66P, 47WLT66
Symptom
Various fault symptoms No Picture, Vertical Lines and Flashing Lines Accross the Screen, see below:
Cause
Faulty LVDS Control PCB.
Cure

Fault Symptoms

No picture.

Vertical lines

Flashing lines across

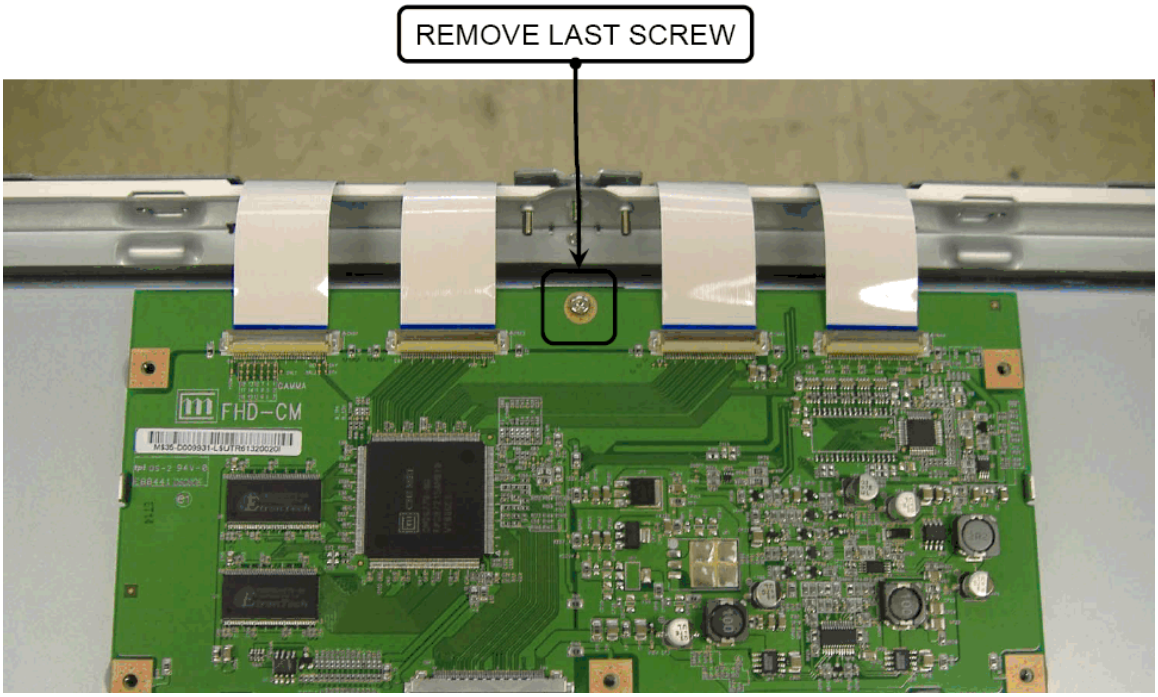

There are two thermal pads under the PCB which will hold the PCB away from the LCD panel. Be careful they do not stick when removing the PCB.

CAREFULLY REMOVE THE TWO ORIGINAL PADS, AND FIT THESE ONTO TO THE NEW PCB

Please replace metal cover with new one provided.

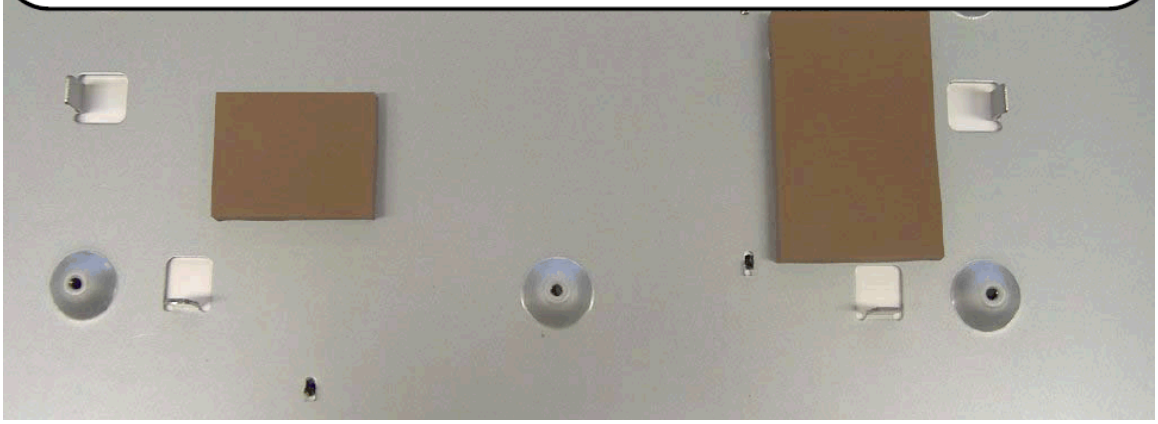

The panel for the 47" displays is part number: 75013119. The part number for the 42" displays varies with panel version but begins: 75008941, then you add the version number to the end. For example: If you require the LVDS control PCB for a "C2" panel in a 42" set, the part number would be: 75008941C2.